ARS 400, ARS 400 pro, ARS 630, ARS 630 pro, smartARS 2 pro, smartARS 3 pro, ARS 630 kVA pro, ARS 1250 pro - accessories

Description			Article No.	Picture			
M10 terminal scr of conductors w (set - 3 pcs.)			53-082961-002				
M12 terminal scre of conductors wit (set - 3 pcs.)			53-082961-003				
V-clamp with tig for connection o with cross-section	f cond	ng torque 30 Nm uctor	1119510081T	T)			
35 - 120 mm²	*	35 - 150 mm ²	11133100011				
35 - 240 mm²	•	35 - 300 mm² •					
V-clamp with tig for connection o section:	ghtenir f cond	ng torque 40 Nm uctor with cross-	1119510084T				
35 - 185 mm²		35 - 240 mm ²		1			
35 - 240 mm²	**	35 - 300 mm ²					
Double V-clamp for connection of with cross-section 50 - 185 mm ²	f two c	ghtening torque 30 Nm onductors 50 - 240 mm ²	1119510082T				
50 - 240 mm²	•	50 - 300 mm ²					
Double V-clamp of for connection of with cross-section 50-185 mm ²	two c	ghtening torque 30 Nm onductors 50-240 mm²	1119510085T				
50-240 mm ²	•	50-300 mm ²					
with lug terminals of 240 mm² to ea	conne and cr ch pha M12 s	ction of two cables ross-section se crews per terminal d.	53-931200-001				
and cable termina For use with ARS ARS 400 with M	2 pro,						
and cable termina For use with ARS ARS 400 with M Cable terminal 3x	2 pro, 120 mi conne and ci ch phase M12 stable te 2 pro,	m ² ction of three cables ross-section se screws rminal shroud. ARS 3 pro,	53-931201-001				







ARS 400-1-V

ARS 400-1-M pro





ARS 630-1-M pro

smartARS 2-1-M pro





smartARS 3-1-M pro

ARS 630 kVA pro



ARS 1250-1-3M pro



PBS 00 - accessories

Description	Article No.	Picture			
Double adapter adjusts the height of PBS 00 to the height PBS 2,3	1115281024T				
Single distance adapter 185/185 for PBS 00/185 adjusts the front line to PBS 1, 2, 3 (set - 3 pcs.)	51-945160-011 (no. regard 1 pc.)				
Double distance adapter 185/185 for two units PBS 00/185 adjusts the front line to PBS 1, 2, 3 at perforation holes in busbar system every 100 mm (set - 3 pcs.)	52-945158-011 (no. regard 1 pc.)				
Fuse link shroud	51-001312-001				



PBS 00-V-0

PBS 2, PBS 3 - accessories

Description		Article No.	Picture		
M10 terminal screw to connection of conducto (set - 3 pcs.)		53-082961-002			
M12 terminal screw to connection of conducto (set - 3 pcs.)		53-082961-003			
V-clamp For connection of conc with cross-section	ductor	1119510081T			
35 - 120 mm² 🛞	35 - 150 mm ²				
35 - 240 mm² 😵	35 - 300 mm² •				
V-clamp For connection of conc with cross-section	ductor	1119510084T			
50 - 185 mm² 🛞	50 - 240 mm²				
50 - 240 mm² 🐠	50 - 300 mm ²				
V-clamp For connection of two with cross-section	conductors	1119510082T			
50 - 185 mm² 🛞	50 - 240 mm ²				
50 - 240 mm² 💎	50 - 300 mm ²				
V-terminal lug for V-cla for connection of cond with cross-section 35 up to 240 mm ²	uctors	1119510002T	O Linearing		



PBS 2-V



PBS 3-V



ACCESORIES FOR PBD FUSE BASES

V-clamps, HS V-clamps (steel)

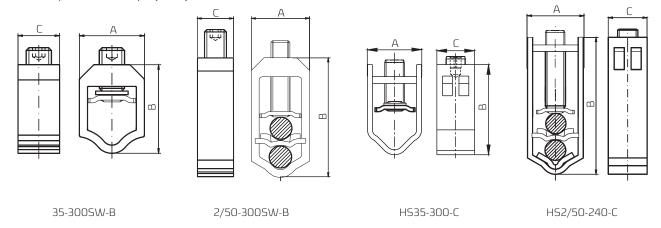


Table 116. V-clamps

	Cross-section of cable conductor [mm²]			Dimension [mm]		T 1		14/-* 1 c			
Article	re	se	rm	sm	width [A]	height [B]	depth [C]	Tightening torque	rial	weight [g]	Article No.
25-150 SW	16÷95	25÷150	16÷95	25÷150	28	38	18,5	20 Nm	alu.	48	1119510091T
HM 10-120	10÷70	25÷120	10÷70	25÷95	28	38	18,5	15 Nm	steel	48	1119510077T
2/25-1205W	16÷95	25÷120	16÷95	25÷120	27,5	58	18,5	30 Nm	alu.	87	1119510006T
35-300SW-B	35÷240	35÷300	35÷185	35÷240	36	49	23	30 Nm	alu.	90	1119510081T
2/50-300 SW-B	50÷240	50÷300	50÷185	50÷240	37	76	23	30 Nm	alu.	177	1119510082T
HS 35-300-C	35÷240	35÷300	35÷185	35÷240	35	55	22	40 Nm	steel		1119510084T
HS2/50- 240-C	50÷240	50÷300	50÷185	50÷240	35	81	22	40 Nm	steel	228	1119510085T

